MAINTENANCE RECORD

F.A.R. 43.9

DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED DATE OF COMPLETION AIRCRAFT TIME IN SERVICE AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE Aviat Husky A-1 N6070H s.n.1000 April-11-2007 total time 1322.6 Hobbs 716.9 Tach 234.2 Drained oil, serviced engine with 8qts. 15/50 Aeroshell oil. Installed new Champion CH 48108-1 oil filter. Installed new Brackett air filter element, Aviat p/n 81632. Adjusted throttle linkage for smoother operation. Installed new Dry air vacuum pump, Rapco p/n RA215CC s/n 25503

	vacuum filter p/ probe p/n 4005] 70 amp as per fa Removed MT prodone at Aviat Ai Richard L. Wel	A&P 65422129	
11/13/2007	HOBBS-834.5 TACH - 329.7	REMOVED HARTEELL 80" PROP	
िया ।		INSTALLED MIT PROP SIND3295 B. Welle	
	Aviat Husky A-1 N6070H s/n 1000 Total Airframe 1526.6 Date August 25, 2009		
	Removed directional indicator Mod. # RCA11A-8, S/N 46M0496G and installed a new directional indicator Mod. # RCA11A-16B, S/N 45F0064. ELT inspected and tested. New batteries installed, dated 2015, remote switch batteries dated 2010. All ADs checked thru 2009-17. Aircraft inspected and serviced as per Aviat Aircraft Inc. Instructions For Continued Airworthiness Model A-1B. dated October 05 " Performed condition inspection I.A.W. scope and detail as outlined in FAR part 43 Appendix D and aircraft was determined to be in a condition for safe operation." Kade Houston A&P 3378308 Aviat Aircraft Inc. Afton Wyoming Factory Service Dept.		